Standard Operating Procedures Truck Detailing

Headlight Restoration Product List 3M™ Car Wash Soap Concentrate, 1 gallon, Clean and Mask PN 38377 Clean the damaged lens with soap and water. Perimeter mask the lens with two layers of masking tape. Scotch® Performance Masking Tape 233+, 18mm x 55m, PN 26334 3M[™] Hookit[™] Soft Interface Sand to Remove Yellowing and Defects Pad, 3 in., PN 05771 Dry DA sand the damaged headlight lens with a 3 in. P500 abrasive disc using a soft interface pad. Completely remove any yellowing and/or 3M™ Purple Clean surface defects. Sanding Hookit™ Disc, 3 in., P500, PN 30272; 3 in., P800, PN 30260 3M™ Trizact™ Hookit™ 1st Step Scratch Refinement Blending Disc, 3 in., Refine the P500 sand scratches by dry DA sanding P1000, PN 02091 with a 3 in. P800 abrasive disc on a soft interface pad. Wipe the headlight lens clean. 3M™ Trizact™ Hookit™ Foam Disc, 3 in., 3000, PN 02087 2nd Step Scratch Refinement Refine the P800 sand scratches by DA sanding 3M™ Perfect-It™ EX with a 3 in. P1000 foam disc on a soft interface Rubbing Compound, pad. Use water to lubricate the P1000 foam 8 oz., PN 36058 abrasive disc. Spend extra time on this step to ensure removal of all P800 sand scratches. Wipe the headlight lens clean. 3M™ Perfect-It™ Foam Buffing Pad, 3 in., PN 30041 3rd Step Scratch Refinement 3M™ Perfect-It™ EX Refine the P1000 sand scratches by DA sanding Machine Polish, 8 oz., with a 3 in. P3000 foam abrasive disc on a soft PN 06093 interface pad. Use water to lubricate the P3000 foam abrasive disc. Spend extra time on this step to ensure removal of all P1000 sand scratches. 3M™ Perfect-It™ Foam Wipe the headlight lens clean. Polishing Pad, 3 in, PN 30042 3M™ Perfect-It™ Detail Compound Lens Cloth, PN 06016 Completely remove the P3000 sand scratches using a 3 in. polishing tool with a foam compounding pad and rubbing compound. Wipe the headlight lens with a clean microfiber cloth.

Think About Your Health

3M[™] E-A-R[™] Skull Screws[™] Ear Plug, PN P1300

3M™ Half Facepiece Respirator, PN 07182

3M™ Virtua™ CCS Protective Eyewear with Foam Gasket, PN 11872



Not a complete list. Select protective eyewear, appropriate gloves, hearing protection, respirator and protective clothing based on your job and exposure assessment.

Polish the headlight lens using a 3 in. foam

Remove the masking tape and inspect

polishing pad and machine polish. Wipe the headlight lens with a clean microfiber cloth.

Polish Lens