

## How to choose the best DMM for your job

Choosing the right digital multimeter (DMM) requires thinking about what you'll be using it for. Evaluate your basic measurement needs and job requirements and then take a look at special features/functions built into many multimeters. Think about whether you need to do basic measurements, or if you need the more advanced troubleshooting options offered by special features.

#### **Factors to consider:**

- Your work environment (voltage level, types of equipment, types of measurements, applications)
- Specialty features/functions (capacitance, frequency, temperature, non-contact voltage, low impedance mode, min/max record, data logging, trending)
- Resolution and accuracy (6,000, 20,000, or 50,000 count resolution)

### **Safety**

The increased occurrence and levels of transient overvoltages in today's power systems have given rise to more stringent safety standards for electrical measurement equipment. Transients that ride on top of power sources (mains, feeder or branch circuits) can trigger a sequence of events that may lead to serious injury. Test equipment must be designed to protect people working in this high-voltage, high-current environment.

### Measurement categories at a glance

	In brief	Examples		
CAT IV	Three-phase at utility connection, any outdoor mains conductors	Refers to the "origin of installation," i.e., where low-voltage connection is made to utility power		
		Electricity meters, primary overcurrent protection equipment		
		Outside and service entrances, service drop from pole to building, run between meter and panel		
		Overhead line to detached building, underground line to well pump		
CAT III	Three-phase distribution, including single-phase commercial lighting	Equipment in fixed installations, such as switchgear and polyphase motors		
		Bus and feeders in industrial plants		
		Feeders and short branch circuits, distribution panel devices		
		• Lighting systems in larger buildings		
		Appliance outlets with short connections to service entrance		
CAT II	Single-phase receptacle connected loads	Appliance, portable tools, and other household and similar loads		
		Outlet and long branch circuits  Outlets at more than 10 meters (30 feet) from CAT III source  Outlets at more that 20 meters (60 feet) from CAT IV source		



#### The largest system of software and wireless test tools in the world.



### Wirelessly relay data with Fluke Connect® Meters

Meters can be used as a stand-alone tool or as part of the Fluke Connect system



### ir3000 FC Connector

Adds the power of the Fluke Connect® mobile app to your measurements.

- Fits over the IR port of your existing Fluke tools (289, 287 or 789)
- Enables you to graph, save, and share readings with your team from your smart phone



### a3000 FC Wireless AC Current Clamp Meter

- Measure up to 400 A ac true-rms
- Inrush function
- Logging function for recording and saving up to 65,000 readings



### a3001 FC Wireless iFlex AC Current Clamp Meter

- Measure up to 2500 A ac with a true-rms flexible current meter
- Record over time (up to 65,000 readings) to monitor circuit load changes for an hour, a shift or a week
- Inrush function



### a3003 FC Wireless DC 2000 A Current Meter

- Measure up to 2000 A dc
- Large jaw size (64 mm) for measuring large or parallel current conductors
- Logging function for recording and saving up to 65,000 readings





### Fluke 279 FC Thermal Multimeter



### Find. Repair. Validate. Report.

The 279 FC is a full-featured digital multimeter with integrated thermal imaging and is designed to increase your productivity and confidence. The thermal multimeter helps you find, repair, validate, and report many electrical issues quickly so that you are confident problems are solved.



# Locate the problem immediately

Thermal imaging multimeters are a first-line troubleshooting tool for electrical equipment that can check hot spots on high-voltage equipment and transformers, detect heating of fuses, wires, insulators, connectors, splices and switches. Scanning with the 279 FC's thermal imager reveals many electrical issues rapidly and from a safe distance. By combining two tools into one, the thermal multimeter lightens the load and increases productivity.



# Expanded functionality

Compatible with iFlex® (a flexible current clamp) to expand your measurement capabilities and get into tight, hard to reach spaces for current measurement (up to 2500 A ac). The large fullcolor LCD screen makes for easier and clearer viewing of images and readings. The 10 hour+ rechargeable battery keeps you going all day long under normal conditions.



# Communicate your results

With built-in Fluke
Connect\*, transmit
results wirelessly to a
smartphone and save
time on reporting to
validate work is complete. Troubleshoot better
by instantly trending
and monitoring measurements live on your
smartphone screen.
Create and email reports
right from the field.





### a3004 FC Wireless DC 4-20 mA Current Meter

- Measure 4 to 20 mA dc signals without breaking the loop
- Logging function for recording and saving up to 65,000 readings



### v3000 FC Wireless AC Voltage Meter

- Measure up to 1000 V true-rms ac
- Logging function for recording and saving up to 65,000 readings



### v3001 FC Wireless DC Voltage Meter

- Measure up to 1000 V dc
- Logging function for recording and saving up to 65,000 readings



### t3000 FC Wireless Temperature Meter

- Measure -200 °C to 1372 °C with k-type thermocouple
- Logging function for recording and saving up to 65,000 readings

# Meters designed for the way you work

	ADVANCE	D METERS	GENERAL PURPOSE				
	289/287	19998 87V	3000 FC	233	179	10001 5 1111 27 IV	
Paris fasteres	203/201	01V	3000 FC	233	119	77 IV	
Basic features Counts	50000	20000	6000	6000	6000	6000	
						6000	
True-rms readings Basic dc accuracy	ac+dc 0.025 %	ac 0.05 %	ac 0.09 %	ac 0.25 %	ac 0.09 %	0.3 %	
Wide bandwidth	100 kHz	20 kHz	0.09 %	0.25 %	0.09 %	0.3 %	
Auto / manual ranging	•/•	• / •	•/•	•/•	•/•	•/•	
Digits	4-1/2	4-1/2	3-1/2	3-1/2	3-1/2	3-1/2	
ATEX II 2G Eex ia IICT4 safety rating Zone 1 and Zone 2	·						
Measurements							
Voltage ac/dc	1000 V	1000V	1000 V	1000 V	1000 V	1000 V	
Current ac/dc	10 A	10 A	400 mA	10 A	10 A	10 A	
Resistance	500 MΩ 1 MHz	50 MΩ 200 kHz	50 MΩ 100 kHz	40 MΩ 50 kHz	50 MΩ 100 kHz	50 MΩ 100 kHz	
Frequency Capacitance	1 MHZ 100,000 µF	200 kHz 10,000 μF	100 kHz 10,000 μF	50 kHz 10,000 μF	100 kHz 10,000 μF	100 kHz 10,000 μF	
•			10,000 μ1			10,000 μ1	
Temperature	(+) 1350 °C	(+) 1090 °C		(+) 400 °C	(+) 400 °C		
Conductance / dB	50 nS / 60 dB	50 nS / -					
Duty cycle / pulse width	•/•	• / -					
Continuity / diode test	(200)	•	•	•	•	•	
Motor Drive (ASD) Measurements  VoltAlert*, non-contact voltage detection	• (289)	•					
VCHEK <sup>™</sup>							
LoZ: low input impedance	• (289)						
Lo ohms	• (289)						
Microamps	•	•					
Display		ı	1	ı			
Fluke Connect®-enabled	•*		•				
Dot matrix display  Dual display	•		•				
Analog bargraph			•				
Backlight	Two level	Two level		•			
Graphical trend display	•						
Diagnostics and data	·	,	·			·	
Min/Max recording / with time stamp	•/•	• / -	• / -	• / -	• / -	• / -	
Fast min/max	250 μs	250 µs					
Display Hold/Auto (Touch) Hold	•/•	•/•	•/•	•/•	•/•	•/•	
Relative reference	•	•					
Stand alone logging Trend capture	•						
Readings memories	10,000		(With FC app)				
USB interface	•		(arro app)				
Other features							
Automatic selection, ac/dc volts							
Overmolded case, integrated holster	•			•		•	
Removable holster		•					
Infrared camera resolution Infrared camera Range							
•			(Mith senarate				
iFlex compatibility			(With separate modules)				
Insulation test voltages							
Pi/DAR timed ratio test							
Completely sealed and watertight							
Operating temperature range Warranty and electrical safety	-20 °C, +55 °C	-20 °C, +55 °C	-10 °C, +50 °C	-10 °C, +50 °C	-10 °C, +50 °C	-10 °C, +50 °C	
Warranty (years)	Lifetime	Lifetime	3	3	Lifetime	Lifetime	
Input alert	·	·					
Dangerous voltage indication		•		•			
IP rating		IP 30	IP 54				
EN61010-1 CAT III	1000 V	1000 V	1000 V	1000 V	1000 V	1000 V	
EN61010-1 CAT IV	600 V	600 V	600 V	600 V	600 V	600 V	

<sup>\*</sup> ir3000 FC Adapter required-sold separately



### COMPACT METERS

### SPECIALTY METERS















	0.0.0	0.0	0.0	100 0		0 0	0 0
	117/115	116	114/113	279 FC	1587 FC	28 II / 28 II Ex	27 II
Basic features	,		,		100110		
Counts	6000	6000	6000	6000	6000	20000	6000
True-rms readings	ac	ac	ac	ac	ac	ac	
Basic dc accuracy	0.5 %	0.5 %	0.5 %	0.09 %	0.09 %	0.05 %	0.1 %
Wide bandwidth					5 kHz	20 kHz	30 kHz
Auto / manual ranging	•/•	•/•	•/•	•/•	• / •	•/•	•/•
Digits	3-1/2	3-1/2	3-1/2	3-1/2	4-1/2	3-1/2 / 4-1/2	3-1/2
ATEX II 2G Eex ia IICT4 safety rating Zone 1 and Zone 2						28 II Ex	
Measurements							
Voltage ac/dc	600 V	600 V	600 V	1000 V	1000V	1000 V	1000 V
Current ac/dc	10 A	600 μΑ		2500 A ac (with iFlex)	400 mA	10 A	10 A
Resistance	40 MΩ	40 MΩ	40 MΩ	50 MΩ	50 MΩ	50 MΩ	50 MΩ
Frequency	100 kHz	100 kHz		100 kHz	100 kHz	200 kHz	200 kHz
Capacitance	10,000 μF	10,000 μF		10,000 μF	10,000 μF	10,000 μF	10,000 μF
Temperature		(+) 400 °C		Infrared Camera -10 °C to 200°C	(+) 537 °C	(+) 1090 °C	
Conductance / dB						60 nS /-	60 nS /-
Duty cycle / pulse width						• / -	• / -
Continuity / diode test	•	•	•	•	•	•	•
Motor Drive (ASD) Measurements				•	•	•	
VoltAlert™, Non-contact voltage detection	• (117)		(110)				
VCHEK™			• (113)				
LoZ: low input impedance	• (117)	•	•				
Lo ohms							
Microamps		•			•	•	•
Display							
Fluke Connect®-enabled				•			
Dot matrix display				•			
Dual display				•			
Analog bargraph	•	•	•			•	•
Backlight	•	•	•	•	•	Two level	Two level
Graphical trend display							
Diagnostics and data	1	,	,		,	1	,
Min/Max recording / with time stamp	• / -	• / -	• / -	• / -	• / -	• / -	• / -
Fast min/max	,	,	,	,	,	250 μs	,
Display Hold/Auto (Touch) Hold Relative reference	• / -	• / -	• / -	•/•	•/•	• / •	• / •
Stand alone logging							
Trend capture							
Readings memories				(With FC app)	(With FC app)		
USB interface				•			
Other features							
Automatic selection, ac/dc volts	• (117)	•	•				
Overmolded case, integrated holster							
Removable holster	•	•	•	•	•	•	•
Infrared camera resolution				80 x 60			
Infrared camera Range				-10 °C, +200 °C			
iFlex compatibility				•	50 V 100 V 250 V		
Insulation test voltages					50 V, 100 V, 250 V, 500 V, 1000 V		
Pi/DAR timed ratio test Completely sealed and watertight							
Operating temperature range	-10 °C, +50 °C	-20 °C, +55 °C	-40 °C, +55 °C / -15 °C, +50 °C	-40 °C, +55 °			
	,	,	,	,	,	-15 C, +50 °C	,
Warranty and electrical safety	2	2	2	2	2	Lifotime / 2	Lifetime
Warranty (years) Input alert	3	3	3	3	3	Lifetime / 3	Lifetime
•		•	•	•	•	•	•
Dangeroug voltage indication					•	•	•
Dangerous voltage indication					ID 40	ID 67	ID 67
Dangerous voltage indication IP rating EN61010-1 CAT III	IP 42 600 V	IP 42 600 V	IP 42 600 V	IP 40 1000 V	IP 40 1000 V	IP 67 1000 V	IP 67 1000 V

### **Digital Multimeter selection chart**



Fluke 289



Fluke 287



Fluke 87V

### Advanced meters

### **Best for**

Advanced industrial troubleshooting, including data logging and graphing intermittent problems.

#### Logging

For unattended monitoring of signals over time, to detect intermittent problems.

### Graphing

View logged values graphically in the field right on the meter, without a PC.

### Working on VSDs

Take accurate voltage, current and frequency measurements on the output side of the drive at either the drive itself or the motor terminals.

# Testing motor windings or contact resistance

Allows testing of resistance up to 50 ohms with one milliohm (0.001 ohm) resolution.

### Best for

Advanced electronic applications, including data logging and graphing intermittent problems.

### Logging

For unattended monitoring of signals over time, and characterize device performance.

### Graphing

View logged values graphically in the field right on the meter, without a PC.

# Monitoring two parameters at the same time

Dual display allows for monitoring of two selectable parameters.

### Performance testing

Testing the frequency response of amplifiers and audio transmission line.

#### **Best for**

Industrial troubleshooting.

### Working on VSDs

Take accurate voltage, current and frequency measurements on the output side of the drive at either the drive itself or at the motor terminals.

### **Industrial troubleshooting**

All of the resolution and accuracy you need to solve more problems on motor drives, in-plant automation, power distribution, and electromechanical equipment.

### **Checking power quality**

Capture glitches and spikes as short as 250 µs. Identify irregular signals.









Fluke 233



Fluke 179

### General purpose meters

#### **Best for**

Fluke FC wireless test tools work together to help you troubleshoot faster.

# Work faster, safer and easier with FC wireless test tools

The 3000 FC Multimeter displays the meter measurement, plus readings from up to three wireless modules, connect to your smart phone to see reading directly on your phone.

# Build the system as your needs grow

Start with the multimeter and future proof your investment.

#### Rest for

Remote display digital multimeter.

# Take measurements in hard to reach places.

With its removable display, you have the flexibility to take measurements in hard to reach places or in areas with restricted access. You can be in two places at once and reduce the risk of arc flash by separating yourself from hazardous measurement situations.

### Work more productively

Now one person can complete a test that would have required two people using ordinary test tools.

#### Best for

Every day use requiring true-rms, accurate, rugged meter.

### Industrial troubleshooting

Applications requiring exceptional ease-of-use, ruggedness and reliability.

# Electrical maintenance and troubleshooting

Variety of commercial electrical troubleshooting, installation and maintenance.

### **Temperature measurements**

Built-in thermometer conveniently allows you to take temperature readings without having to carry a separate instrument.

## **Digital Multimeter selection chart**



Fluke 117



Fluke 116



Fluke 115



Fluke 113

### Compact meters

### **Best for**

Wide variety of electrical work.

# Electrical maintenance troubleshooting

When you need to eliminate false or "ghost" voltages or perform continuity, connection or basic wiring checks.

# Non-contact voltage detection

Integrated non-contact voltage detection simplifies many tasks.

### Best for

HVAC trouble-shooting.

# Residential HVAC maintenance

Lower voltage HVAC residential maintenance, installation and troubleshooting.

# Temperature and microamp measurements

Troubleshooting problems with HVAC equipment and flame sensors.

### **Best for**

Electronic and field service applications.

# Electronic troubleshooting

Troubleshoot a wide variety of measurement parameters, including frequency and capacitance.

### **Best for**

Utility applications involving basic electrical tests.

### Revenue meter tests:

Involving meter sets and reconnects, capacitor checks, detection of absence or presence of voltage, and for continuity, connections or basic wiring checks.

# Simultaneous voltage and continuity checks

Check LoZ low impedance function allows users to check voltage and continuity simultaneously.









Fluke 1587 FC



**Fluke 28 II/27 II** 



Fluke 28 II Ex

### Specialty meters

### **Best for**

First-line troubleshooting.

Helping you find, repair, validate and report on electrical issues quickly, gives you the confidence that the problem has been solved.

# Locate the problem immediately

Checking for hotspots on high voltage equipment and transforming and motors.

### **Increased productivity**

Use the thermal imager to scan for problems and then use the digital multimeter further troubleshoot

# Preventive maintenance simplified, rework eliminated

Save time and improve the reliability of your maintenance data by wirelessly syncing measurements directly to an asset record or work order using the Fluke Connect® system.

### **Best for**

Troubleshooting and preventative maintenance around motors, generators, and switch gear.

### **Insulations tests:**

The insulation of electrical power systems can be tested for system performance, system safety, system reliability and as part of asset management.

### Moisture tests:

Carrying out PI/DAR timed ratio tests with TrendIt™ graphs to identifies moisture and contaminated insulation problems.

### Working on VSDs

Take accurate voltage, current and frequency measurements on the output side of the drive at either the drive itself or the motor terminals.

### **Best for**

Harsh environments requiring dustproof and waterproof test equipment.

### Industrial troubleshooting for indoor and outdoor harsh environments

Dustproof, waterproof, shockproof multimeter designed to withstand the toughest environments.

# Working on variable speed drives (VSDs) Take accurate voltage, current and frequency measurements on the output side of the drive at either the drive itself or at the motor terminals. (28 II only)

#### **Best for**

Industrial troubleshooting in explosive environments.

### Safety and compliance

The Fluke 28 II Ex is an intrinsically safe digital multimeter designed for use in dangerous or explosive atmospheres.

### **Agency approvals**

IECEx Ex ia IIC T4 Gb, Ex ia IIIC T130 °C Db, I M1 Ex ia I Ma.

# Industrial troubleshooting

Completely sealed, IP67 rated case; Withstands drops up to 10 feet or 3 meters (with holster); dustproof per IEC60529 IP6x; waterproof per IEC60529 IPx7; meets IEC Overvoltage Electrical Safety Standard No. 61010–1:2001.



# New Fluke 289

# True-rms Industrial Logging Multimeter with TrendCapture

### **Technical Data**

### The Best Just Got Better.


The new 289 is the next generation high performance industrial logging multimeter designed to solve complex problems in electronics, plant automation, power distribution, and electro-mechanical equipment. With the ability to log data and review it graphically on-screen, you can solve problems faster and help minimize downtime. Let the new 289 be your watchdog for systems or processes while you are off solving other problems.

# Equipped with new

### New – TrendCapture quickly graphically displays logged data session to quickly deter-

- mine whether anomalies may have occurred

   New Zoom on trend provides unprecedented ability to view
- New Zoom on trend provides unprecedented ability to view and analyze TrendCapture data; zoom in up to 14 times
- New Selectable ac filter (Smoothing mode) helps display a steadier reading when the input signal is changing rapidly or noisy
- New Adjustable recording and auto hold thresholds, specify a percentage change in the readings that begins a new event
- New Large 50,000 count, 1/4 VGA dot matrix display with white backlight
- New Logging function with expanded memory for unattended monitoring of signals over time. Using on-board TrendCapture users can graphically review logged readings without needing a PC. Store up to 15,000 recorded events.
- New Save multiple logging sessions before pc download is necessary

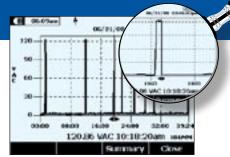

TrendCapture displays vDC logged date.

- New Two terminal 50 ohm range with 1 milliohm resolution, 10 mA source current.
   Useful for measuring and comparing differences in motor winding resistance or contact resistance.
- New Low Pass filter for accurate voltage and frequency measurements at the same time on adjustable speed motor drives and other electrically noisy equipment
- New LoZ Volts. Low impedance voltage function for eliminating ghost voltages. Also recommended when testing for absence or presence of live power.
- New (i) button. On board help screens for measure– ment functions. Unsure about a function—go to that function and press the "i" button.
- Real time clock for automatic time stamping of saved readings



- Relative mode to remove test lead resistance from low ohms or capacitance measurements
- True-rms ac voltage and current for accurate measurements on non linear signals
- Measure up to 10 A (20 A for 30 seconds)
- 100 mF capacitance range
- Peak capture to record transients as fast as 250 µs
- Optional magnetic hanger for easy setup and viewing while freeing your hands for other tasks
- Optically isolated communication port for transferring data to pc (usb cable and software optional)
- Limited lifetime warranty



### **Specifications**

Function	Range and Resolution	Basic Accuracy
DC volts AC volts	50.000 mV,500.00 mV, 5.0000 V, 50.000 V, 500.00 V, 1000.0 V	0.025 % 0.4 % (true-rms)
DC current AC current	500.00 μA, 5000.0 μA, 50.000 mA, 400.00 mA, 5.0000 A, 10.000 A	0.15 % 0.7 % (true-rms)
Temperature (excluding probe)	-200.0 °C to 1350.0 °C (-328.0 °F to 2462.0 °F)	1.0 %
Resistance	50.000 $\Omega$ , 500.00 $\Omega$ , 5.0000 $k\Omega$ , 50.000 $k\Omega$ , 500.00 $k\Omega$ , 500.00 $k\Omega$ , 500.00 $k\Omega$	0.05 %
Capacitance	1.000 nF,10.00 nF 100.0 nF, 1.000 μF, 10.00 μF, 100.0 μF, 100.0 μF, 1000 μF, 10.00 mF	1.0 %
Frequency	99.999 Hz, 999.99 Hz, 9.9999 kHz, 99.999 kHz, 999.99 kHz	.005 %

<b>Additional Functions/Features</b>	Fluke 289
Multiple on screen displays	Yes
True-rms ac bandwidth	100 kHz
dBV/dBm	Yes
DC mV resolution	1 μV
Megohm range	up to 500 MΩ
Conductance	50.00 nS
Continuity beeper	Yes
Battery/fuse access	Battery/fuse
Elapse time clock	Yes
Time of day clock	Yes
Min-max-avg	Yes
Duty cycle	Yes
Pulse width	Yes
Isolated optical interface	Yes
Auto/touch hold	Yes
Reading memory	Yes
Log to PC	Yes
Interval/event logging	Yes
Logging memory	up to 15,000 readings

# General specifications

# Maximum voltage between any terminal and earth ground: 1000 V

Battery type: 6 AA alkaline batteries, NEDA 15A IEC LR6 Battery life: 100 hours minimum, 200 hours in logging mode

**Temperature:** 

Operating: -20 °C to 55 °C Storage: -40 °C to 60 °C

**Relative humidity:** 0 to 90 % (0 t 37 °C), 0 to 65 % (37 °C to 45 °C), 0 to 45 % (45 °C to 55 °C)

### **Electromagnetic compatibility:**

EMC EN61326-1

2.38 in)

**Vibration:** Random vibration per MIL-PRF-28800F Class 2

**Shock:** 1 meter drop per IEC/EN 61010-1 2nd Edition

**Size (HxWxL):** 22.2 cm x 10.2 cm x 6 cm (8.75 in x 4.03 in x

Weight: 870.9 g (28 oz)

# Ordering information

289 True-rms Industrial Logging Multimeter with TrendCapture

### **Optional accessories**

FVF-SC2 FlukeView® Forms
Software with Cable
TLK289 Industrial Test Lead Set
i400 AC Current Clamp
i410 AC/DC Current Clamp
80BK Integrated DMM
Temperature Probe

TPAK Magnetic Hanging Kit

C280 Soft Case



# Fluke Connect™ ir3000 FC Connector

### **Technical Data**

Connect your Fluke test tool with the ir3000 FC Connector and get all the benefits of the Fluke Connect mobile app

If you already have one of the tools below in your tool box or tool belt or are considering purchasing one, add the ir3000 FC Connector so you can communicate with Fluke Connect<sup>TM</sup> app.

- Fluke Connect ir3000 FC Connector allows you to wirelessly transfer data from your existing Fluke tools to your smart phone
- Fits over the IR port of your existing Fluke tools
- Immediately enables you to graph, save, and share the tool's readings with your team from your smart phone
- Identify and diagnose problems quickly and confidently
- Efficiently and safely capture real-time readings of the primary display from the field
- · Share results instantly with your team
- Upgradeable by USB

### **Supported Fluke tools:**

• Digital Multimeter: 287, 289

• Process Tool: 789

### **Supported smart phones:**

- Android<sup>™</sup> 4.4 & up
- iPhone® 4s & later

Review the information on both models below to ensure you are selecting the one that supports your existing Fluke tool. Next, download the Fluke Connect mobile app from the Apple or Google app store and get started.





### See it. Save it. Share it. All the facts, right in the field.

Fluke Connect with ShareLive™ video call is the only wireless measurement system that lets you stay in contact with your entire team without leaving the field. The Fluke Connect mobile app is available for Android™ (4.4 and up) and iOS (4s and later) and works with over 20 different Fluke products—the largest system of connected test tools in the world. And more are on the way. Go to the Fluke website to find out more.

Make the best decisions faster than ever before by viewing all temperature, mechanical, electrical and vibration measurements for each equipment asset in one place. Get started saving time and increasing your productivity.

Download the app at:







Smart phone, wireless service and data plan not included with purchase



### General specifications

Model	FLUKE-IR3000FC	
Battery type	Two AAA Alkaline batteries, ANSI-24A IEC-LRO3	
Battery life	6 hours of continuous transmission	
RF communications	2.4 GHz ISM Band	
RF communication range	Open air, unobstructed: Up to 20 m Obstructed, sheetrock wall: Up to 6.5 m Obstructed, concrete wall or steel electrical enclosure: Up to 3.5 m	
Temperature	Operating: -10 °C to 50 °C	
	Storage: -20 °C to 60 °C	
Certifications	CSA, FCC, CE, IC	
Warranty	Three years	
Weight	80 g	
Size (HxWxL)	3.2 cm x 7.6 cm x 6.4 cm (1.25 in x 3.0 in x 2.5 in)	
Compatibility	Fluke 187, 189, 287, 289, 789	

### Ordering information

FLUKE-IR3000FC Fluke Connect ir3000 FC Connector

RF connection time (binding time) may take up to 1 minute.



# Fluke 289 FlukeView® Forms Combo Kit



Maximize productivity with the combined Fluke 289 and FlukeView® Forms Combo Kit. With built-in data logger and TrendCapture capability, the 289 helps you track down elusive, intermittent problems, monitoring equipment with any of its functions while you do other jobs. Using FlukeView Forms software allows you to overlay your logged data from six meters or six time periods to find cause and effect relationships or for condition monitoring. Turn your data into meaningful graphs and tables for a professional report or analyze individual readings or series of measurements. The 289/FVF combo kit gives you a practical and affordable approach to predictive maintenance.

### Fluke-289/FVF Kit includes:

- Fluke-289 True-rms Industrial Logging Multimeter with TrendCapture, LoZ, LoPass filter, and Lo Ohms
- FVF-SC2 FlukeView Forms Software and cable
- TL71 Silicon Test Lead Set
- AC72 Alligator Clips
- 80BK-A Integrated DMM Temperature Probe
- TPAK Magnetic Meter Hanger for hands-free operation
- C280 Soft Case for meter protection and accessory storage

### **Technical Data**

### 289 functions and features

Multiple on-screen displays	Yes
LoZ	Yes
50 ohm range	Yes
Filter for measure- ments on motor drives	Yes
True-rms ac band- width	100 kHz
DBV/dBm	Yes
DC mV resolution	1 μV
Megohm range	500 MΩ
Conductance	50.00 nS
Continuity beeper	Yes
Temperature (°C and °F)	-200 °C to 1350 °C
Battery/fuse access	Yes/Yes
Elapse time clock	Yes
Time of day clock	Yes
Min-Max-Avg	Yes
Frequency	Yes
Duty cycle/pulse width	Yes
Info button on board help	Yes
Hold	Yes
Isolated optical interface	Yes
Auto/touch hold	Yes
Reading memory	Yes
Log to PC	Yes
On board logging with TrendCapture	Yes
Logging memory	180 hours





# Ordering information

**Fluke-289/FVF** True-rms Logging Multimeter Combo Kit with TrendCapture

### 289 specifications

Function	Range and resolution	Basic accuracy
DC volts	50.000 mV,500.00 mV, 5.0000 V,	0.025 %
AC volts	50.000 V, 500.00 V, 1000.0V	0.4 % (true-rms)
DC current	500.00 μA, 5000.0 μA, 50.000 mA,	0.15 %
AC current	400.00 mA, 5.0000 A, 10.000 A	0.7%(true-rms)
Temperature (excluding probe)	-200.0 °C to 1350.0 °C (-328.0 °F to 2462.0 °F)	1.0 %
Resistance	50.000 $\Omega$ (289 only), 500.00 $\Omega$ , 5.0000 kΩ, 50.000 kΩ, 500.00 kΩ, 5.0000 MΩ, 50.00 MΩ, 500.0 MΩ	0.05 %
Capacitance	1.000 nF,10.00 nF 100.0 nF, 1.000 μF, 10.00 μF, 100.0 μF, 1000 μF, 10.00 mF, 100.00 mF	1.0 %
Frequency	99.999 Hz, 999.99 Hz, 9.9999 kHz, 99.999 kHz, 999.99 kHz	0.005 % + 1