SERVICE PARTS LIST

Milwankee

SPECIFY CATALOG NO. AND SERIAL NO. WHEN ORDERING PARTS REVISED BULLETIN M12™ FUEL™ Multi-Head Drill STARTING SERIAL NO CATALOG NO. 2505-20 **K81A**

42-70-0058

42-55-2501

31-44-2504

14-20-2505

10-20-3098

22 23

30

31

32

Housing Clip

Zippered Tool Bag

Housing Assembly

Electronics Assembly

Warning Label (Not Shown)

			CATALOG NO.	2505-20	SERIAL NO). NOTA		
00 -	00 Component Parts (Small #) Are Included							
VALUE OF CONTROL TO A SECURITION OF CONTROL								
	Which Older	iling The Assem	bly (Large #).		Cui de la companya de	30 7 8 9 10 13 14 15 16 17 22 32		
							[55] [5] [6] [7] [22] [32]	
		SCREW TO	RQUE SPECIFICATI					
				TORQUE				
FIG.	PART NO.	DESCRIPTIO	N	(IN-	LBS)			
12	06-82-2500	8-32 x 7mm P	an Hd. T-15 Machine	Screw 5	5-7		14	
15	06-82-5315	M3 x 26.5mm	Pan Hd. ST T-10 Sc	rew 6	5-8			
16	06-82-1080	M3 x 14mm P	an Hd. ST T-10 Scre	w 5	5-7			
		23	S. C	3 × 3	1 3	1a 2 1a		
1M:	lwaukee		L.		/			
1114			M'		/			
					/			
							12	
	(/			
13-						/ 0		
						22		
	2				' \{\bar{\bar{\bar{\bar{\bar{\bar{\ba			
16—	- N						10	
(6x)	/] ie			1 ^{1a}	
	$\bigwedge f$			A is a	1			
~								
			1829					
			\\ \	Aldi I.	[] `s			
<i>></i>	/ / // /		M	21 3 1 1	<i> </i>			
/				Y. J.	//// ///			
17	, /				//////	7		
45				8				
15 (3x)								
		6						
		,						
FIG.	PART NO.	DESCRIPTION		NO. REQ.				
1	14-29-2505		h Clutch Assembly	(1)			_21	
1a	44-10-0196	Speed Select		(1)				
2	45-24-0231	Speed Select		(1)				
3	16-01-2504	Rotor Assem		(1)				
7 8		Magnet Bit H	older	(1)				
9		Magnet LED Lens		(1) (1)				
10		Light Pipe		(1)				
11	42-70-0095	Belt Clip		(1)				
12	06-82-2500		Pan Hd. T-15 Machin				20	
13		Housing Cov		(1)				
14		Housing Sup		(1)				
15	06-82-5315		Pan Hd. ST T-10 Sc					
16	06-82-1080		Pan Hd. ST T-10 Scre	, ,				
17 18	12-20-2512 42-66-0019	Service Name	epiate /8" Keyless Chuck	(1)				
19	14-72-0100		/8 Reyless Chuck Right Angle Drive (RA	(1) (D) (1)			9	
20	14-72-0100		Offset Attachment	(1) (1)				
21	14-35-0155		lex Attachment	(1)				
22	42-70-0058			(1)				


(1) (1)

(1)


(1)

(1)


WIRING INSTRUCTIONS

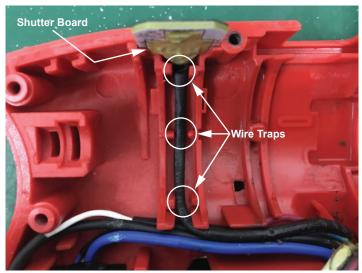


Tuck Shutter Board squarely and firmly in slotted recess of housing support. Push wires completely down in wire traps.

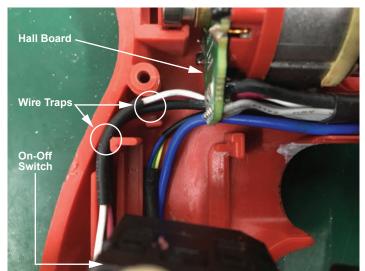

Push black and white wires completly down in wire traps. Route blue and yellow wires behind on-off switch.

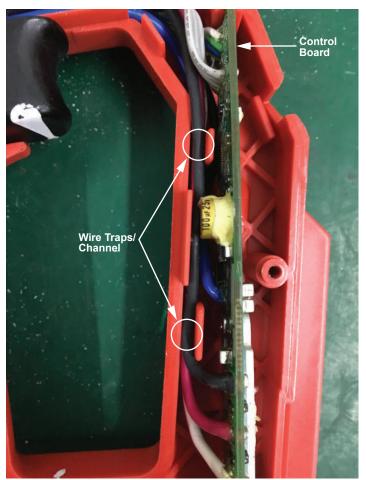

Route all control board wires through wire traps/channel as shown. Be sure to push wires completely down in traps. Be sure control board is seated squarely and firmly in support housing.

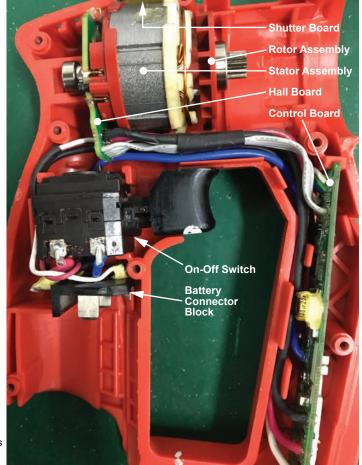

Be sure all elements of the electronics assembly are firmly seated in the support housing. Be sure all wires are pushed completely down in wire traps and channels. Make sure there is no interference prior to installing the housing cover.