

BULLETIN # 358

TO: AUTHORIZED Portable Electric Tool SERVICE STATIONS factory SERVICE CENTERS SALES COMPANIES

FROM: Corbert A. Garb - National Service Manager

TOOL(S) \ PRODUCT(S) AFFECTED

23-66-1020 Switch, 23-66-1021 Switch Kit

1001-1, 1006-1, 1101-1, 1105-1, 1106-1, 1201-1, 1250-1, 1251-1 ½" D-Handle Drill 1610-1, 1630-1, 1665-1, 1/2" Compact Drill, 1670-1, 1675-1, 1679-1 1/2" Hole-Hawg[®] Drill

SUBJECT: PRODUCT SAFETY RECALL

For operator safety and in cooperation with the U.S. Consumer Products Safety Commission [CPSC] the Management of Milwaukee Electric Tool Corporation wants you to be aware of a defect existing in some 23-66-1020 Switches. 23-66-1020 Switch is a component of the 23-66-1021 Switch Kit; service replacement of a 23-66-0751 Switch.

23-66-1020 Switches and 23-66-1021 Switch Kits sold between May 30, 2000 and February 27, 2001 are affected. Affected switches carry a manufacture's four [4] digit date code of 0021 thru 0044 imprinted on its body.



Product Recall 23-66-1020 SWITCH

with date code 0021 thru 0044

PLEASE POST THE ENCLOSED – SAFETY RECALL – POSTER FOR ALL CUSTOMERS TO READ.

For operator safety all 1001-1, 1006-1, 1101-1, 1105-1, 1106-1, 1201-1, 1250-1, 1251-1 1/2" D-Handle Drill; 1610-1, 1630-1, 1665-1, ½" Compact Drill; 1670-1, 1675-1, 1679-1 ½" Hole-Hawg® Drill received for repair must be inspected for the presence of a **23-66-1020** Switch with a date code within 0021 through 0044 [21st thru 44th week of 2000].


If the unit contains a recalled 23-66-1020 Switch please complete an Individual Tool Warranty Report form covering the no-charge replacement of the switch.

Please enclose the replaced defective 'recalled' switch with the copy of the Individual Tool Warranty Claim form when submitted for payment. . No credit will be issued for a warranty claim that does not have a switch returned with it.

This bulletin is for informational purposes. PLEASE NOTE ON SERVICE PARTS LIST; Domestic 54-08-1025, -1026, -1027, -1080, -1081, -1082, -1083, -1084, -1085, -1086, -1120, -1121, -1140, -1141, -1142, -1143, -1144, -1145, -1146, -1180, -1181, -1182, -1183, -1184, -1185, -1186, -2020, -2021, -2022, -2023, -2024, -2060, -2061, -2062, -2063, -2064, -2065, -2066, -2067, -2250; 54-10-0025, -0100, -0101, -0102, -0103, -0104, -0105, -0106, -0110, -0111, -0112, -0113, -0114, -0115, -0140, -4000, -4001, -4002, -4003, -4004, -4005, -4006, -4007, -4008, -4009, -4010, -4011, -4012, -4013, 4026, -4027, -4028, -4029, -4030, -4031, -4032, -4033, -4034, -4035, -4036



For operator safety Milwaukee Electric Tool Corporation wants you to be aware of defect existing in a service replacement switch supplied to us from the Eaton Corporation Switch 23-66-1020

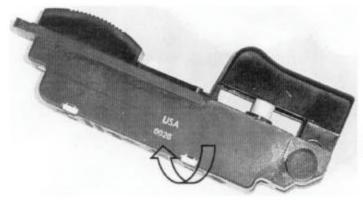

Milwaukee

Product Recall 23-66-1020 SWITCH with date code 0021 thru 0044

What is affected & potential risk of injury:

Milwaukee 23-66-1020 Switch and Switch Kit 23-66-1021, containing a 23-66-1020 Switch, sold between June, 2000 and March, 2001, with a four [4] digit date of manufacture code of 0021 thru 0044 imprinted on the switch body, <u>may stick in the 'ON' position</u> which could lessen control of the product and subject an operator to a risk of injury. There has been one injury reported.

What to do:

Please inspect any 23-66-1020 Switch or Switch Kit 23-66-1021, purchased for or installed in the repair of a 1/2" D-Handle, Compact or Hole-Hawg® Drill between June, 2000 and March, 2001, for a 0021 thru 0044 date code.

23-66-1020 Switch and 23-66-1021 Switch Kit are used in the servicing of and are a service replacement part for 1/2" D-Handle [Cat No. 1001-1, 1006-1, 1101-1, 1105-1, 1106-1, 1201-1, 1250-1, 1251-1] Compact [Cat. No. 1610-1, 1630-1, 1665-1] and Hole-Hawg^e [Cat. No. 1670-1, 1679-1] Drills.

Milwaukee is offering the immediate free replacement of a recalled switch.

Simply return the switch or tool the switch was installed in to the nearest Milwaukee factory Service Center, Milwaukee Authorized portable electric tool Service Station or to Milwaukee Electric Tool Corporation at the address shown. Milwaukee will reimburse you for any shipping expense.