
WIRING INSTRUCTIONS

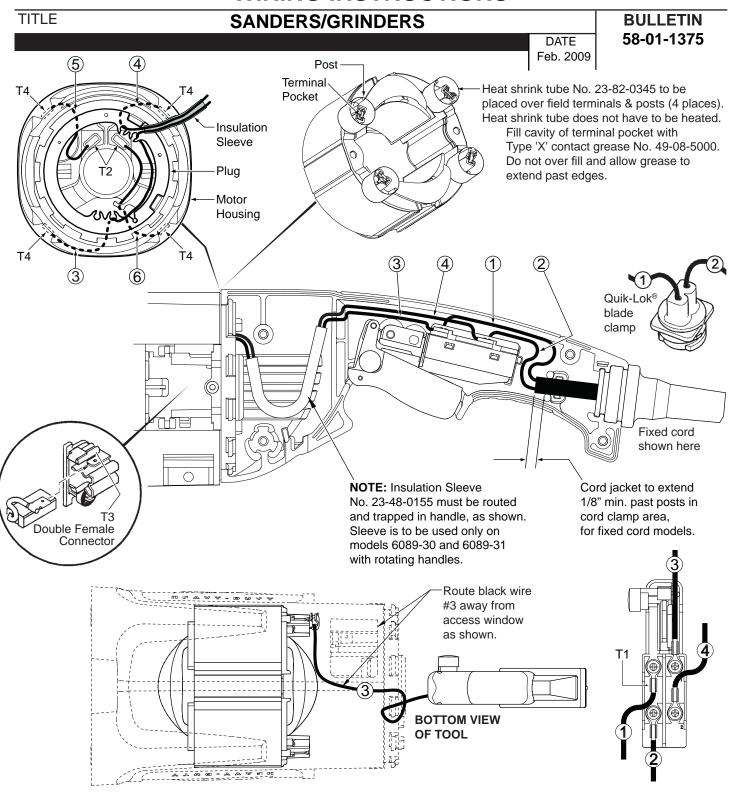

WIRING SPECIFICATIONS						
Wire No.	Wire Color	Origin or Gauge	Length	Terminals, Connectors and 1 or 2 End Wire Preparation		
1	Black	Cord/Bld Hsg		Component of cord or blade housing assembly. Strip 5/16" for T1.		
2	White	Cord/Bld Hsg		Component of cord or blade housing assembly. Strip 5/16" for T1.		
3	Black	16	13-5/16"	23-94-9310. Strip 7/32" for T1/Strip 5/32" for T4.		
4	White	16	11-1/4"	23-94-9315. Strip 7/32" for T1/Strip 5/32" for T4.		
5	Red	16	5-1/4"	23-94-9300. Strip 7/32" for T2/Strip 5/32" for T4.		
6	White	16	5"	23-94-9305. Strip 7/32" for T2/Strip 5/32" for T4.		

BULK LEAD WIRE - BULLETIN NO. 58-01-0003


T1	TO SWITCH
T2	TO MOTOR HOUSING
Т3	TO BRUSH HOLDER

TO FIELD

T4

TERMINAL DESCRIPTION				
Code	Part No.	Qnty.		
T1	23-74-0850	4		
T2	23-74-0610	2		
T3	23-74-2115	2		
T4	23-74-0585	4		

WIRING INSTRUCTIONS

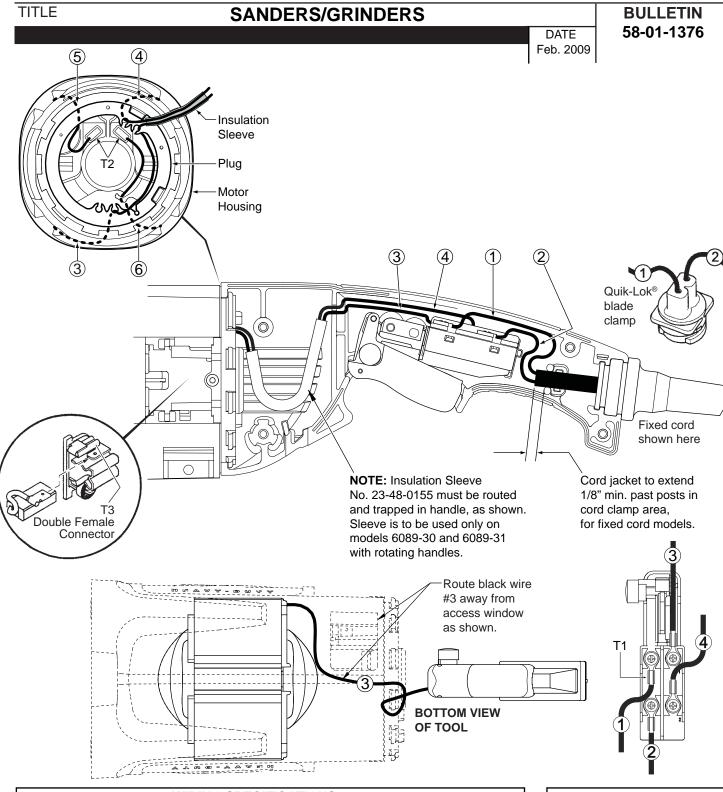

WIRING SPECIFICATIONS					
Wire No.	Wire Color	Origin or Gauge	Length	Terminals, Connectors and 1 or 2 End Wire Preparation	
1	Black	Cord/Bld Hsg		Component of cord or blade housing assembly. Strip 5/16" for T1.	
2	White	Cord/Bld Hsg		Component of cord or blade housing assembly. Strip 5/16" for T1.	
3	Black	14	12-3/4"	Component of field. Strip 5/16" for T1.	
4	White	14	11"	Component of field. Strip 5/16" for T1.	
5	Red	16	5-3/4"	Component of field. Strip 7/32" for T2.	
6	White	16	5"	Component of field. Strip 7/32" for T2.	
BULK LEAD WIRE - BULLETIN NO. 58-01-0003					

T1	TO SWITCH
T2	TO MOTOR HOUSING
T3	TO BRUSH HOLDER

TERMINAL DESCRIPTION					
Code	Part No.	Qnty.			
T1 T2 T3	23-74-0850 23-74-0610 23-74-2115	4 2 2			
L	20712110				

Drwg. 1